


## LIMA\_11\_SV\_14\_5KCRUSH

Company:  
 User:  
 Result file: C:\CamsizerXT\CAMDAT\LIMA\_11\_SV\_14\_5KCRUSH\LIMA\_11\_SV\_14\_5KCRUSH077.rdf  
 Task file: C:\CamsizerXT\CAMSYS\LIMA\_11\_SV\_14\_5KCRUSH.afg  
 Time: 5/20/2015, 13:29, duration 26 min 24 s at 0.5 % covered area, image rate 1:1, with X-Fall, gap width = 7.0 mm

Particle model: xc\_min  
 No. of particles: CCD-B = 32409455, CCD-Z = 0  
 Velocity adaption: no  
 Fitting: no

Material:

| ASTM(+) | No(-) | retained [%] | passing [%] | SPHT3 | Symm3 | b/l3  | PD0      |
|---------|-------|--------------|-------------|-------|-------|-------|----------|
| > #16   |       | 0.0          | 100.0       |       |       |       | 0        |
| #20     | #16   | 0.0          | 100.0       |       |       |       | 0        |
| #30     | #20   | 0.0          | 100.0       |       |       |       | 0        |
| #40     | #30   | 0.0          | 100.0       |       |       |       | 0        |
| #50     | #40   | 0.0          | 100.0       | 0.708 | 0.756 | 0.739 | 315      |
| #60     | #50   | 1.4          | 100.0       | 0.879 | 0.872 | 0.776 | 16305    |
| #70     | #60   | 12.0         | 98.6        | 0.916 | 0.898 | 0.775 | 228626   |
| #140    | #70   | 80.1         | 86.6        | 0.926 | 0.904 | 0.748 | 4495127  |
| PAN     | #140  | 6.5          | 6.5         | 0.930 | 0.893 | 0.707 | 27669081 |

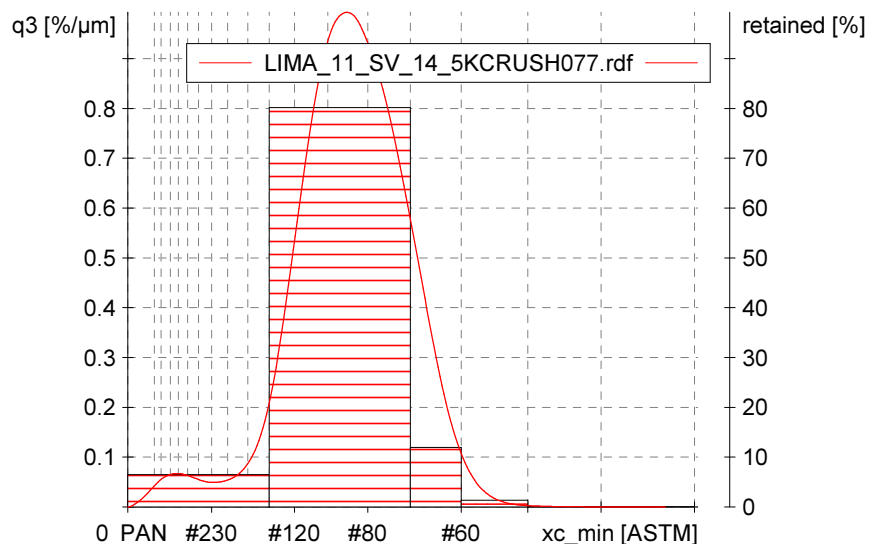

## Characteristics

| Q3 [%]      | x [μm]   |
|-------------|----------|
| 10.0        | 118.2    |
| 50.0        | 168.0    |
| 90.0        | 218.2    |
| SPAN3 =     | 0.595    |
| U3 =        | 1.508    |
| Mv3(x) =    | 166.5 μm |
| Sigma3(x) = | 42.8 μm  |

Mean value SPHT3 = 0.918  
 Mean value Symm3 = 0.901  
 Mean value b/l3 = 0.738  
 Mean value RDNS\_C3 = 0.474  
 Mean value SPHT\_K3 = 0.683

User